



Continental Aerospace
Technologies GmbH
Platanenstrasse 14
09356 Sankt Egidien, Germany

Tel: +49 37204 696 0
Fax: +49 37204 696 2912
www.continentaldiesel.com
support@continentaldiesel.com

SB CG 125-1029 P2, Initial Issue

SERVICE BULLETIN PRIORITY 2 – RECOMMENDED

Service Bulletin No. / Date: SB CG 125-1029 P2, Initial Issue / November 13, 2023

Subject: Replacement of Fuel Feed Pump

Type affected: TAE 125-02-125 (CD-170)

Models affected: Fuel Feed Pump P/N 05-7312-K024301 and P/N 05-7312-K024302 with S/N:

15796	16132	16385	16736
15797	16134	16387	16737
15798	16137	16676	16738
15799	16138	16678	16739
16043	16377	16679	16740
16044	16378	16680	16741
16045	16379	16681	16742
16047	16380	16682	16743
16051	16382	16684	
16052	16383	16735	

Classification: Category P2 – Recommended

Time of Compliance: Measures have to be accomplished within the next 100 flight hours or with the next maintenance, whichever occurs first.

Reason: Cases have been reported where the engine has failed to start in hot environments. The root cause are adverse inappropriate tolerances with the consequence that the fuel pressure is too low for starting the engine.

Correction: Replace the affected fuel feed pump in accordance with RM-02-02, Chapter 73-10.25 Issue 5, Rev. 1 or later approved revision.

Checked 13.11.2023 T. Franke, CVE	Approved 13 Nov. 2023 D. Hartung, Office of Airworthiness
---	---

Replaces Service Bulletin No. / Date: -

Page 1 / 2



Continental Aerospace
Technologies GmbH
Platanenstrasse 14
09356 Sankt Egidien, Germany

Tel: +49 37204 696 0
Fax: +49 37204 696 2912
www.continentaldiesel.com
support@continentaldiesel.com

SB CG 125-1029 P2, Initial Issue

Remarks: Labor Effort: 2.5 hours

Parts:

Item	Part Number	Description	Quantity
1	05-7312-K024302	Fuel Feed Pump	1
2	05-9920-S000401	Installation Set Fuel Feed Pump	1

Approval: The technical content of this document is approved under the authority of the
DOA ref. EASA.21J.010.