

Service Letter

Service Bulletin No. SL TMG 000-1006, Initial Issue
Date: September 15, 2017

Subject: oil contaminated electrical contacts

Type affected: all

Models affected: all

Classification: Category SL – SERVICE LETTER

Time of Compliance: -

Reason: Maintenance problems were discovered due to oil contaminated contacts. This could lead to electrical contact problems and possibly to a malfunction.

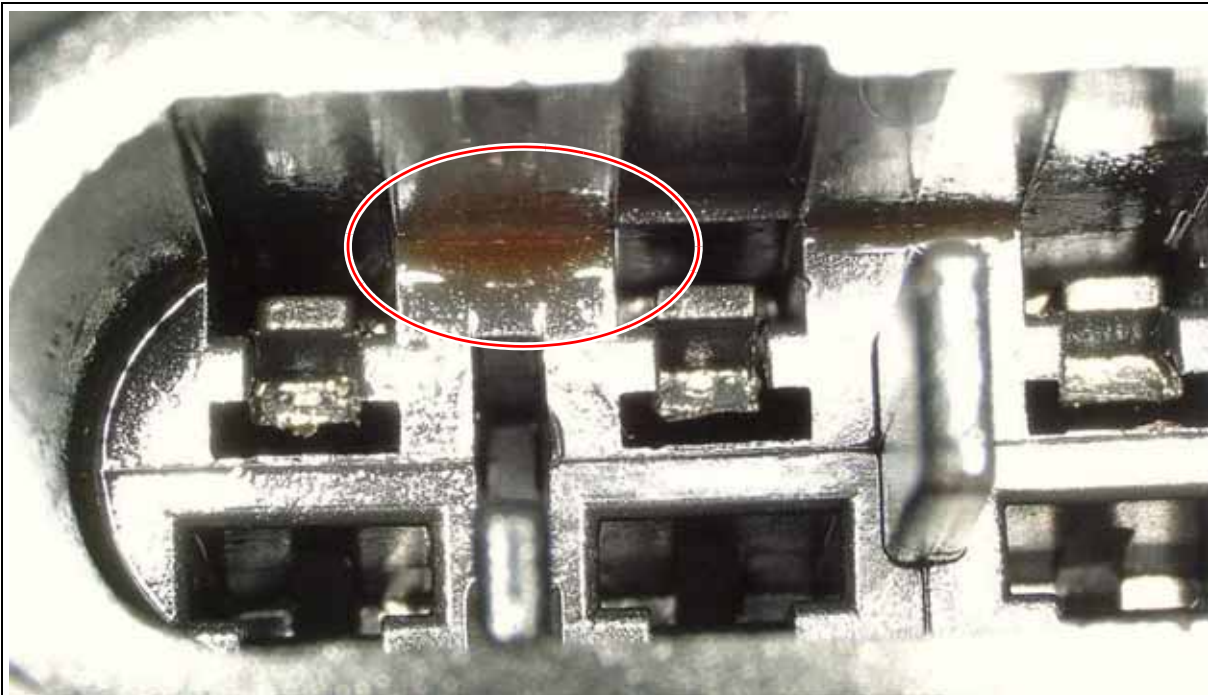





Figure 1 oil contaminated plug housing

Checked A. Wille, CVE 	Approved D. Hartung, Office of Airworthiness 
--	--

Replaces Service Bulletin No. / Date:

-

 Technify Motors	<p style="text-align: center;">Technify Motors GmbH Platanenstrasse 14 09356 Sankt Egidien, Germany</p>	<p>Tel: +49 37204 696 0 Fax: +49 37204 696 2912 www.centurion-engines.com info@centurion-engines.com</p>
--	---	--

SL TMG 000-1006, Initial Issue

- Correction:** When changing or filling oil or coolant it must be ensured that the plugs are not contaminated with oil, coolant or other fluids.
Make sure that the plugs are properly closed or protected by appropriated plugs.
If plugs get contaminated, clean the contaminated components with appropriate silicone-free cleaner for electrical equipments, e.g. Rivolta S.L.X. 500 before starting the System.
Clean the plug and the socket.
- Remarks:** -
- Parts:** -
- Approval:** The technical information contained in this document has been approved under the authority of EASA Design Organisation Approval No. EASA.21J.010.